



RELEASE NOTES

**Product: HTI-404 (ref. 3864)
HTI-424 (ref. 3863)**

Version: 3.0.4

Date: 09/04/19

1. GENERAL INFORMATION

1.1 Purpose and coverage

HTI products form an advanced ClassA quad transmodulator range, with universal input (DVB-S/S2, DVB-T/T2 or DVB-C) and DVB-T, DVB-C or IP (only in HTI-424) output. It also includes two Common Interface slots for service decryption (only in HTI-424).

This document describes the new features, compatibility issues, solved problems, and known issues to solve associated with this product release.

1.2 List of releases

- 3.0.4
- 3.0.3
- 3.0.1
- 2.0.0
- 1.2.0

1.3 Product identification

1.3.1 Software review

Software release of the system is checked through a web browser.

After accessing HTI headend via the web, go to Menu / Firmware Management. Check information of CURRENT FIRMWARE VERSION.



Firmware Upgrade Management for the headend

CURRENT FIRMWARE VERSION

VERSION
1.2.0+d20180612

AVAILABLE FIRMWARE VERSION

VERSION

UPLOAD A FIRMWARE UPDATE

[Add Firmware File](#)

1.3.2 Hardware review

Not applicable. All HW versions are supported.

1.4 Compatibility information

1.4.1 Supported HW

Not applicable. All HW versions are supported.

1.4.2 Backwards compatibility notes

It is not possible to downgrade.

RELEASE NOTES

Product: HTI-404, HTI-424

Version: 3.0.4

Date: 09/04/19



2. RELEASE HISTORY

- **Software release 3.0.4** (9/04/2019)
 - **New features**
 - None.
 - **Resolved issues**
 - Some modules are constantly reset, blocking access to them. In the case that the affected module is the master, access to the web interface is unstable.
 - **Known issues**
 - Tune DVB-S2 45MSymb/s satellite signal may take up to 90 seconds.
 - IP configuration obtained in DHCP mode is not visible in configuration reports.

- **Software release 3.0.3** (01/03/2019)
 - **New features**
 - Processing of audio streams for new languages, such as Croatian or Serbian is added.
 - **Resolved issues**
 - An error that made it difficult to save changes in the list of services, detected in version 3.0.1 is fixed.
 - The error that caused that audios appeared blocked when updating a module from version 1.2.0 is fixed.
 - False decrypting alarms problems that caused a delay to start descrambling in some CAMs are solved.
 - **Known issues**
 - Tune DVB-S2 45MSymb/s satellite signal may take up to 90 seconds.
 - IP configuration obtained in DHCP mode is not visible in configuration reports.

- **Software release 3.0.1** (15/02/2019)
 - **New features**
 - Generation of IPTV output (SPTS and MPTS) is added.
 - Fixed IP access mode is added. DHCP mode and programmable fixed IP are still available..

RELEASE NOTES

Product: HTI-404, HTI-424

Version: 3.0.4

Date: 09/04/19



- Default IP address in RJ45 interface: 192.168.184.101.
It is accessible only from 192.168.184.100.
- Default IP address in USB interface: 192.168.184.253.
It is accessible only from 192.168.184.252
- RJ45 interface is no longer supported by IKUSI Headend Discovery.
- **Resolved issues**
 - Loss of streams problems detected in 2.0.0 are solved.
 - False decrypting alarms problems detected in 2.0.0 are solved.
 - MMI interface of a slave HTI was not accessible.
 - CAMs could not be reseted from web interface.
- **Known issues**
 - Tune DVB-S2 45MSymb/s satellite signal may take up to 90 seconds.
 - Some CAM models may take up to 120 seconds to start descrambling.
 - IP configuration obtained in DHCP mode is not visible in configuration reports.
- **Software release 2.0.0** (03/12/2018)
 - **New features**
 - Support for new HTI-424 transmodulator.
 - Supports two CAM slots for service decryption.
 - Supports changing input mode between four inputs or one input + loopthrough.
 - Improved service selection GUI.
 - Bit rate measurement for each PID and service.
 - Supports for Ka band signals.
 - Supports PSI/SI decryption.
 - Improved support for selection of signal source, either through a multiswitch or from a LNB directly.
 - **Resolved issues**
 - When the HTI is accessed through a PC with Italian language, some menus were not shown properly.
 - Services can't be removed from a carrier in overflow status.

RELEASE NOTES

Product: HTI-404, HTI-424


Version: 3.0.4

Date: 09/04/19

- **Known issues**
 - Tune DVB-S2 45MSymb/s satellite signal may take up to 90 seconds.
 - Some CAM models may take up to 120 seconds to start descrambling.
 - IP configuration obtained in DHCP mode is not visible in configuration reports.
 - Exceptionally, IKUSI Headend discovery may fail to detect headends. Headend reboot solves the problem.

3. UPGRADE INSTRUCTIONS

3.1 Installation environment

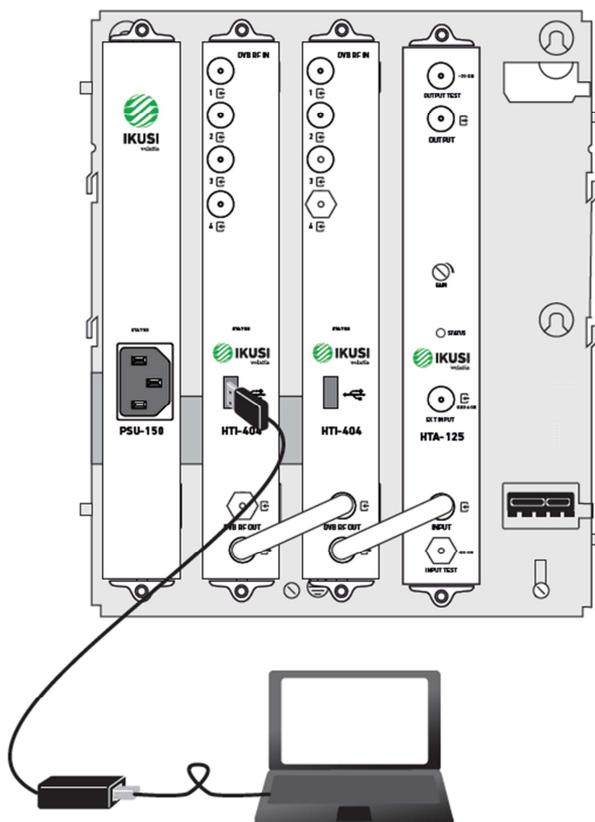

RELEASE NOTES

Product: HTI-404, HTI-424

Version: 3.0.4

Date: 09/04/19



3.2 Equipment/modules checking

In order to ensure that there is no configuration or hardware issues (service, signal, etc. Issues) check that there are not active alarms.

3.3 Software upgrade procedure

Follow these steps:

- Download the latest version from our website
<https://www.ikusi.tv/en/products/hti-404>
- Connect the pc to the USB port of the master module, located in the slot 2 of the base-plate, with a USB-ethernet adapter.
- Enter the following data, User: Admin Password: admin. Push Submit button. The main screen of the configuration interface will open, from where you can configure the headend.
- Go to Menu / Firmware Management.
- Go to UPLOAD A FIRMWARE UPDATE section

RELEASE NOTES

Product: HTI-404, HTI-424

Version: 3.0.4

Date: 09/04/19



Firmware Upgrade Management for the headend

CURRENT FIRMWARE VERSION

VERSION
1.2.0+d20180612

AVAILABLE FIRMWARE VERSION

VERSION

UPLOAD A FIRMWARE UPDATE

[Add Firmware File](#)

- Select the firmware through Add Firmware File button. After that, push Upload button. Once the firmware has been uploaded, it will appear in the AVAILABLE FIRMWARE VERSION section.
- Push the Install button associated with the desired firmware version.
- After pushing Install button, the upgrade progress screen will open.

RELEASE NOTES

Product: HTI-404, HTI-424

Version: 3.0.4


Date: 09/04/19



Pº Miramón, 170 · 20014 San Sebastián · SPAIN
Tel.: +34 943 44 89 44 · Fax: +34 943 44 88 20
television@ikusi.com www.ikusi.tv



- At the conclusion of the upgrade (10' approx), a message will appear as follows:

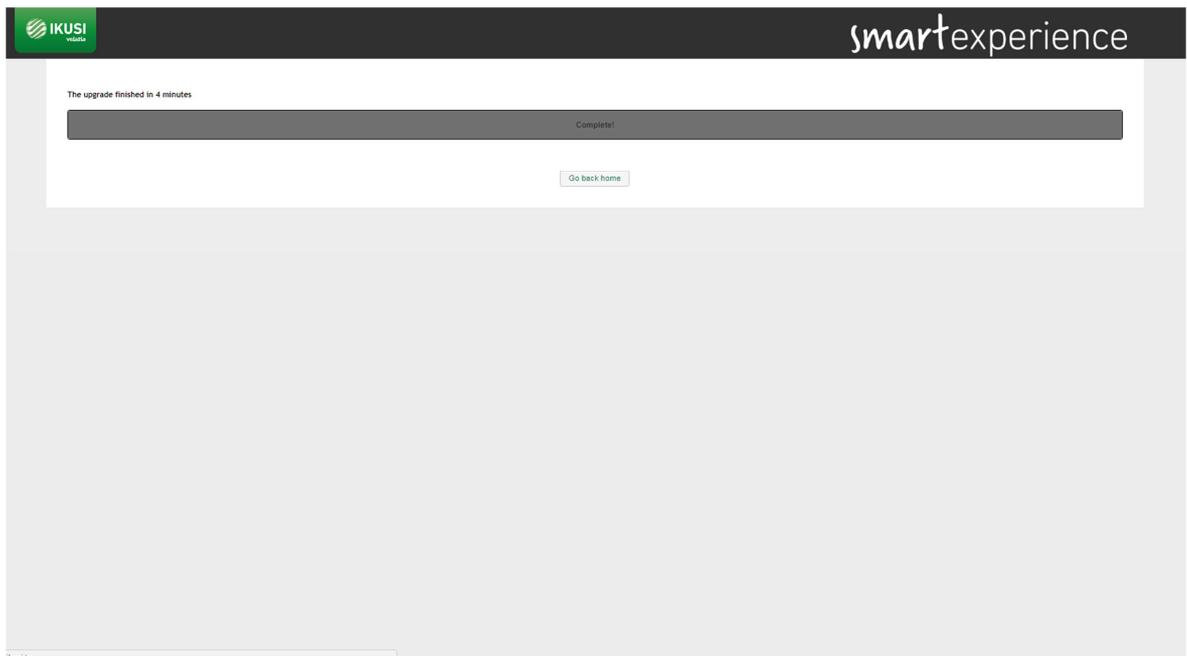

- Push Go back home button. The web interface will redirect you to Overview screen.

RELEASE NOTES

Product: HTI-404, HTI-424

Version: 3.0.4

Date: 09/04/19